To be scanned RR00144

| THIS DOCUMENT | CONSISTS | 0F | 15 | PAGEISI |
|---------------|----------|----|----|---------|
| T             |          |    |    |         |

NWSSGR 92-2 COPY


B57-531 DOE-DNA TP B57-531 SWOP NAVY 11N-B57-531 T.O. AIR FORCE

# TECHNICAL MANUAL NUCLEAR WEAPONS RETROFIT ORDER ALT 914 (U)

PALADRAPH CASSINCATION: Personal to and to accordance with special authorsanton granted by the Devetor, Information Security Oversight Office, this sechaical publication is no person marked is atherwise would be required by DOD 5300,1-R. This publication will not be used as a security classification guide with respect to its content nor as an approved source for arriving at classification determinations.

or the authority of the Secretaries of the Nevy and Air Force, the coor, Defune Nuclear Agency, and the Department of Energy.

# ROUGH DRAFT

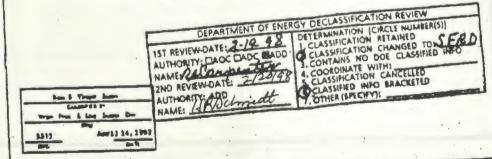

DOE - Sandia National Laboratories, Albuquerque

27 APRIL 1992

Constant and State Constants

B-3

A. C. Bar

UNCLASSIFIED

Contraction and a second contract of the

-----

PORSERAN RESTRICTED

Unintractized disclacate iciministratives and Cristiant 144.

manuton Section

Act 1954

101

Dete

Reamcted

5

endia

# LASSIFIED

COPY

## LTG DRAFT

NOT RELEASED .

B57-531



.

2. 4. 1. .

Å.

-----

-

.

NWSSGR

92-2

COPY

Representations for mountilitary two of the information or discretions remained in this publication is an permitted. Representation for military on is enablished for the Army in AR 330-5, for the Novy is OPNAVDIST 3510.1-metric and DOD Directive 5200.1-metric for the Air Force in Air Force Reputation 205-1.

LIST OF EFFECTIVE PAGES

When applicable, insert latest change pages; dispose of superseded pages is accordance with

NOTE: When applicable, on a change page, the portion of the text affected by the latest change is indicated when applicable, on a change page, the portion of the saturation by the saturat change is indicated by a vertical line in the margin of the page. The portion of the illustration affected by the latest change is indicated by a minimum pointing hand, shading and acrossing, or a vertical line in the

Total sumber of pages in this manual is 16, consisting of the following: ....

Pare No. Title A i and ii J thru 11 Authenticatio

-----

-----

.

. . . :

A

. ...

intransi at alian

. .. 

times dive

. ...

. .

Aller .

1 .....

- 18 A.

en en sel systemet en sel sel en systemet en sel se


Change No. Original Original

> 1.140 . 1

•••

.

Original Original Original



and a state of the state of the

1524

. . .

## LASSIFIED

COPY




#### NWSSGR 92-2 COPI

13.3.8. A. 91

LTG DRAFT NOT RELEASED





B57-531

### SAFETY PRECAUTIONS

## ELECTROSTATIC SENSITIVE DEVICES (ESSD).

The B57 contains ESSD's which are sensitive to static electricity. When these devices are exposed to electrostatic discharge, personnel safery and/or weapon function may be affected. These devices may be either electroexplosive devices (EED) or nonexplosive devices. Failure to equalize body potential with that of the weapon or component, as directed in this manual, may activate or damage the ESSD's. Do not touch the electrical connector pins or connector sockets.

If operations being carried out under ESSD Warnings are interrupted and/or actions are taken that may build up static electricity, personnel must equalize their body potential with that of the weapon or component before resuming operations.

Refer to TP 35-51 for information on Protecting Electrical Connectors.


## HAZARDOUS EXPENDABLE MATERIALS.

Procedures in this manual require the use of hazardous expendable materials. These hazardous expendable materials are identified in the sext by (HM). The user must be familiar with (or refer to) the Material Safety Data Sheet (MSDS) and applicable OSHA regulations (as implemented by Service policies) for each hazardous expendable material used in the day's operation. The using organization shall determine what, if any, additional protection is required. However, all regulatory standards must be met.

Hazardous expendable materials may be additionally identified in the text by (HM)(F). These materials are flammable. The user must be familiar with (or refer to) the manufactures's MSDS, OSHA regulations, and local regulations (as implemented by Service policies) for proper use procedures.

B-5

# UNCLASSIFIED

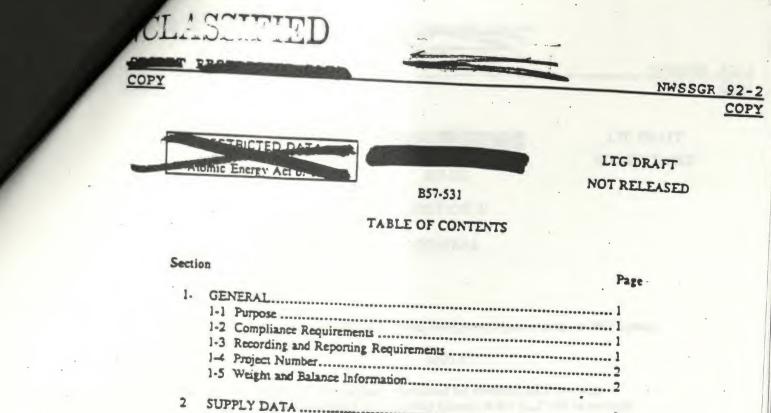

3

UNCLASSIFIED

1 - 15-

terreture Palar . ..


......

. .....

12.00

an term

B-6

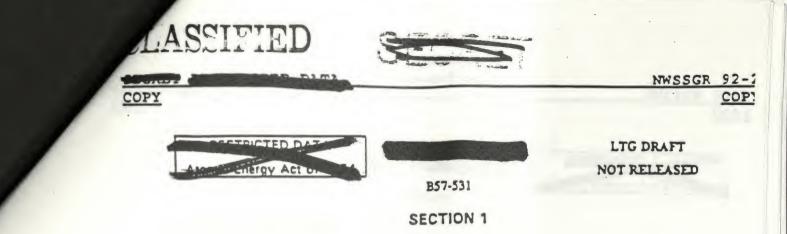

## 1-1 PURPOSE.

1-1.1 This retrofit order provides procedures to improve shipment safety of B57 bombs.

#### NOTE

GENERAL

ALT 914 is reversible. Procedures for reversing ALT 914 will either be provided in a technical manual, or the ALT will be reversed by DOE personnel using special repair procedures.

1-1.2 This retrofit will be performed on all B57's before shipment by air.

1.2 COMPLIANCE REQUIREMENTS.


1-2.1 BY WHOM WORK WILL BE ACCOMPLISHED. The work required by this retrofit order will be performed by Service and DOE team personnel (where applicable) at all locations having B57's.

1-2.2 WHEN WORK WILL BE ACCOMPLISHED. This reprofit will be completed before air shipment of any B57 and following receipt of this manual by the organization possessing the bomb.

1-2.3 MAN-HOURS REQUIRED. Retrofit of a single B57 requires approx. 1 hr, not including preparation time.

#### 1-3 RECORDING AND REPORTING REQUIREMENTS.

Accomplishment of this retrofit will be reported and recorded using appropriate Service procedures. For Navy, refer to SWOP 1-2.



The second second

adding a star

dia an



B-7

1:



2.

UNCLASSIFIED

- --

LTG DRAFT NOT RELEASED

LASSIFIED

B57-531

B-8



NWSSGR 92-2

COPY

#### 1-4 PROJECT NUMBER

1-4.1 The project number for this retrofit is Product Change Proposal number 2-92.

1-4.2 Reporting will reference TP B57-531.

## 1-5 WEIGHT AND BALANCE INFORMATION.

The weight and balance change resulting from performance of this retrofit is negligible.



COPY

----

. . . .

475-

÷.,

11.00

Address Autors

-A-1-

. . . . . . . . .

CLASSIFIF

.



COP

3

the stand to a stand



B57-531

LTG DRAFT NOT RELEASED

SECTION 2

#### SUPPLY DATA

#### 2-1 TP MANUAL.

Performance of this retrofit requires reference to TP B57-1.

#### 2-2 PARTS AND MATERIALS.

2-2.1 STENCILING MATERIALS. Service will provide materials required for stenciling ALT number (par. 3-3.1).

2-2.2 OTHER PARTS AND MATERIALS. The DOE team will furnish all other parts and materials required to perform this retrofit. Table 2-1 lists connector covers required to perform the retrofit, and table 2-2 lists required expendable materials.


#### 2-3 TOOLS AND EQUIPMENT.

2-3.1 SERVICE PERSONNEL. Refer to Special Equipment listing in TP B57-1 for tools required to perform this retrofit.

2-3.2 DOE TEAM. The DOE team will equip themselves with tools and materials required to perform procedures in par. 3-2.

#### 2-4 DISPOSITION OF REMOVED PARTS.

No parts are removed from the B57 when performing this retrofit.





# CLASSIFIED

COPY

as Francisco in al air is

. ••

1.1 


11. 4

÷.

. .

LTG DRAFT NOT RELEASED





NWSSGR 92-2

COPY

TABLE 2-1

B57-531

CONNECTOR COVERS

| ITEM | PART NO. | QUANTITY |
|------|----------|----------|
|      |          |          |
| 1    | <        |          |

#### TABLE 2-2

EXPENDABLE MATERIALS

| ITEM NUMBER | NOMENCLATURE                      |       |
|-------------|-----------------------------------|-------|
| 299         | Lacquer (black lusteriess) (HM)(F |       |
| 532         | Texuile tape                      | - 142 |

B-10



Although a start

.....

• • •



B57-531 SECTION 3

### MODIFICATION DATA

### 3-1 PRELIMINARY OPERATIONS.

#### NOTE

- This retrofit is performed (where applicable) with B57's in twohigh stack in H1012 Hand Truck. Do not unstack bombs.
- Service personnel perform procedures in section 3-1.

3-1.1 MONITOR READY-SAFE SWITCH. Check position of ready-safe switch by looking through forward observation window in center bomb subassembly. The ready-safe switch should be in S (green) position. If ready safe-switch is in R (red) position, remove SEP (par. 3-1.2), if installed, and reject B57.

3-1.2 REMOVE MC1386 STRIKE-ENABLING PLUG (SEP). Check for presence of SEP by looking through aft observation window in center bomb subassembly. If SEP is installed, remove it as follows.

a. Remove observation window assembly using 1-1/4-in. socket wrench installed on inverted nut.

b. Grasp SEP and pull out to remove.

c. Reinstall observation window and tighten securely.

#### NOTE

B-11

5

Cathan 200 Bat was and


SEP is not reinstalled as long as bomb remains ALT 914.

d. Package SEP according to TP B57 procedures for Packaging Strike-Enabling Plug.



.....



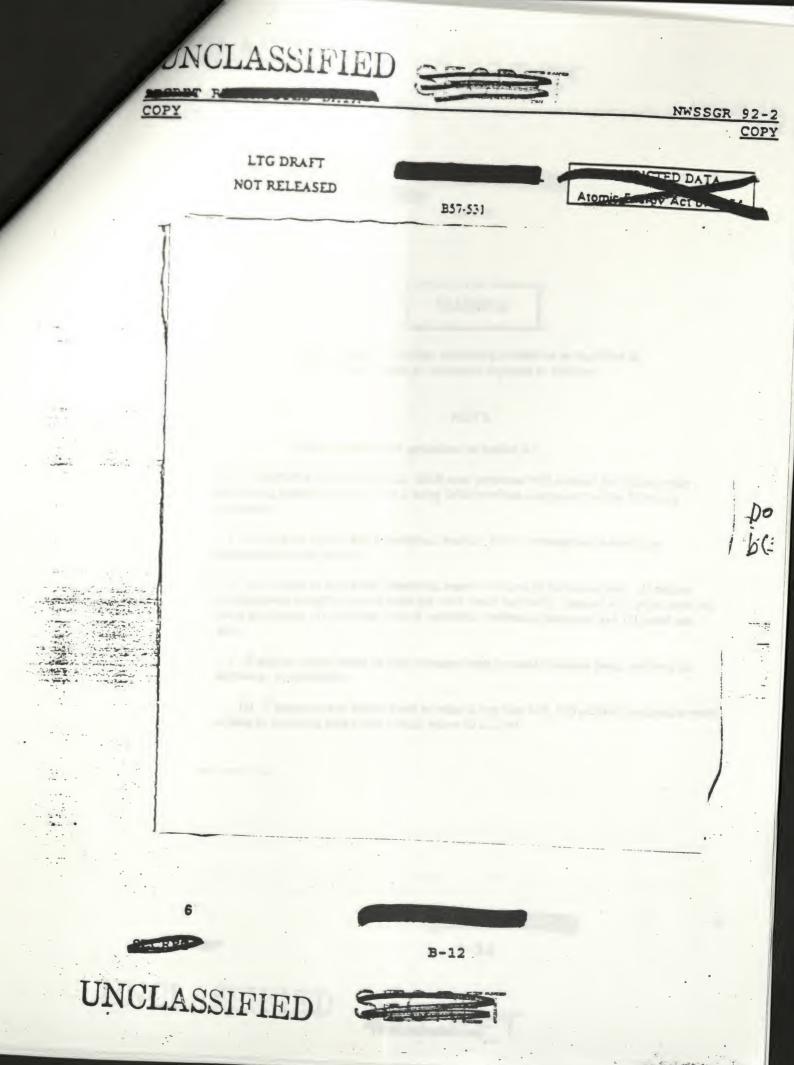

.

Sa de l'andre Sign



LTG DRAFT NOT RELEASED

NWSSGR

92-

COP

7

3-2 REWORK.

UNCLASSIFIEI

Alomi

TRICTED

TY ACT OF 195



B57-531

Failure to perform tritium monitoring procedures as described in par. 3-2.1 may result in undetected exposure to trituium.

#### NOTE

## DOE team performs procedures in section 3-2.

3-2.1 TRITTUM MONITORING. DOE team personnel will monitor for tritium while performing procedures in par. 3-2.2 using DOE-provided equipment and the following procedures.


a. At the start of each day's operation, monitor bunker atmosphere to determine background natural activity.

b. At the start of each bomb operation, monitor the area of the access door. If tritium contentrations exceed 50 microcuries per cubic meter ( $\mu$ Ci/m<sup>3</sup>), proceed with panel removal while monitoring (1) breathing zone of technician performing operation and (2) panel scal area.

c. If tritium concentration rapidly increases upon removal of access panel, perform the following, as applicable.

(1) If atmosphere at access panel location is less than 100, 000  $\mu$ Ci/m<sup>3</sup>, continue to work as long as breathing zone levels remain below 50  $\mu$ Ci/m<sup>3</sup>.

B-13



|     | ASSIFIED                  |         |                     |
|-----|---------------------------|---------|---------------------|
| COL | PY<br>PY                  |         | NWSSGR 92-2<br>COPY |
|     | LTG DRAFT<br>NOT RELEASED |         | RESTRICTED DAT      |
|     |                           | B57-531 |                     |
|     |                           | NOTE    |                     |

Following actions are based on assumption there was a build up of trutium in the center bomb subassembly.

(2) If breathing zone levels exceed 50  $\mu$ Ci/m<sup>3</sup>, but are less than 500  $\mu$ Ci/m<sup>3</sup>, reinstall access panel (par. 3-2.4), retreat from the immediate area, and continue to monitor bunker atmosphere. Observe monitors from a distance to determine if tritium concentration is decreasing. When tritium concentration becomes less than 50  $\mu$ Ci/m<sup>3</sup>, reenter area and again remove access panel. If tritium concentration again exceeds 50  $\mu$ Ci/m<sup>3</sup>, but does not increase rapidly, leave panel off and allow center bomb subassembly to ventilate. Resume operations when ventilation reduces levels below 50  $\mu$ Ci/m<sup>3</sup>.

(3) If breathing zone levels increase rapidly and exceed 500  $\mu$ Ci/m<sup>3</sup>, evacutate area immediately (do not reinstall access panel). From a distance, observe whether tritium concentration is still increasing. If it is, evacutate the bunker and allow time for the tritium to ventilate.

3-2.2 REMOVE ACCESS PANEL. Perform the following.

a. Remove eight machine screws that secure access panel door to center bomb subassembly.

b. Remove access door and gasket. Use tools for tapping and prying as required. Retain screws, door, and gasket for reinstallation.

3-2.3 DISCONNECT CABLES. Perform the following.

#### WARNING

Failure to equalize body potential where indicated, or touching connector sockets, may activate an ESSD and cause personal injury or loss of life. This warning applies to procedures in steps b through g. Reequalization is required after interruption of procedures.


a. Equalize body potential with that of center bomb subassembly by touching bare metal inside access area.


b. Disconnect P15 of MC181- Interconnecting Box pigtail (P13 on Mod 1. ALT 259) from J2 of MC1391 Thermal Fuse Pack (fig. 3-2). Use connector pliers as necessary.



State of the second state



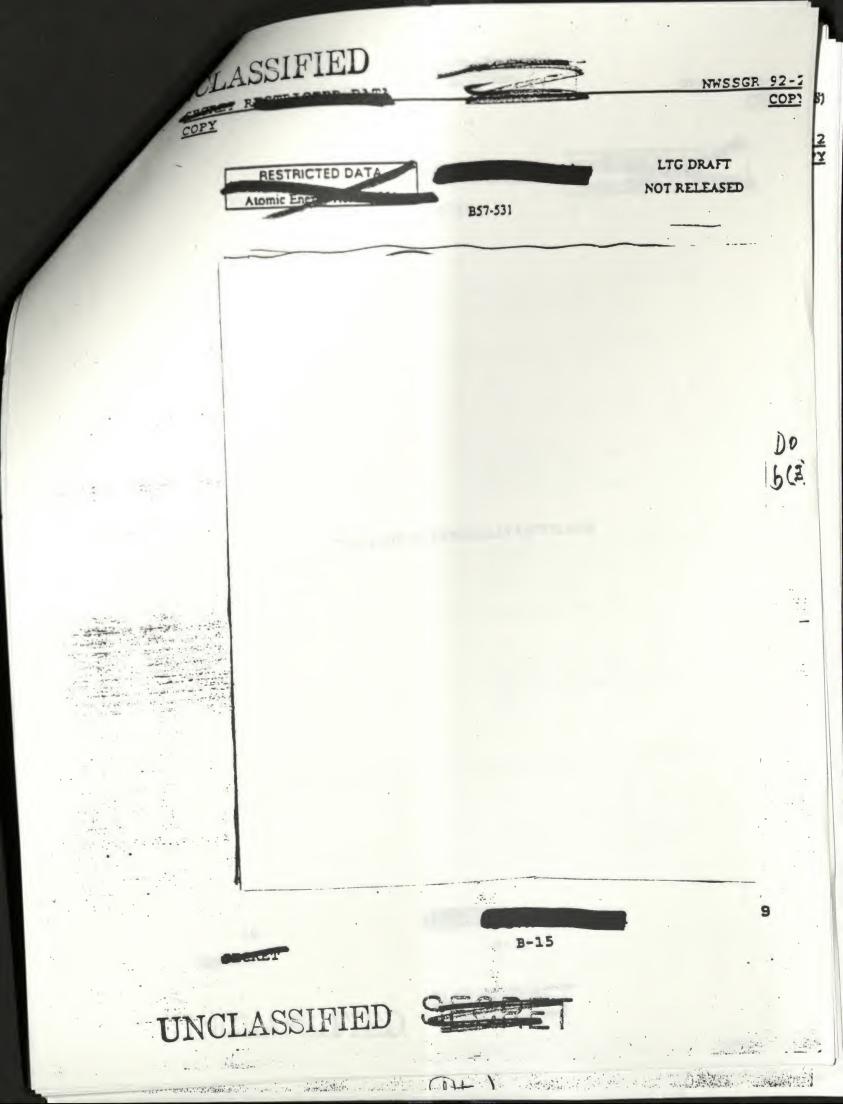

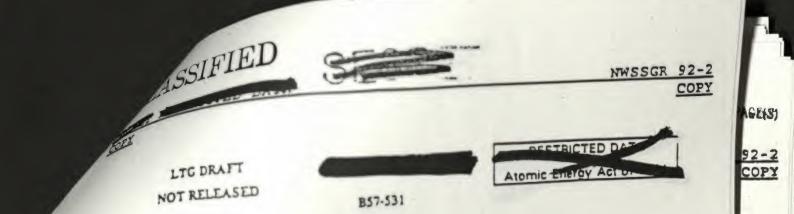

THIS PAGE INTENTIONALLY LEFT BLANK


B-16

UNCLASSIFIED

10

S

Committee in the second of the

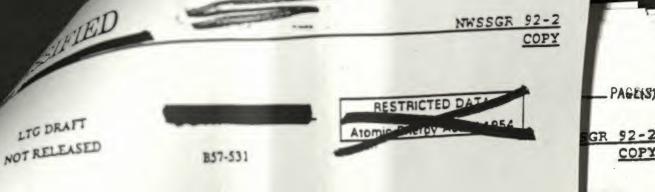

DEPARTMENTS OF THE NAVY AND AIR FORCE Washington, D.C., 27 April 1992

531

531 531

92

Section of the sector of the

BY ORDER OF THE SECRETARIES OF THE NAVY AND AIR FORCE:

OFFICIAL: MICHAEL W. CLAYBURN Commander, United States Navy Naval Liaison Officer, JNWPS

J. T. HOOD Rear Admiral, United States Navy Deputy Commander Naval Sea Systems Command

CHARLES C. McDONALD, General, USAF Commande: Air Force Logistics Command

MERRILL A. MCPEAK, General, USAF Chief of Staff United States Air Force

This publication is issued for the use of Defense Nuclear Agency personnel.

OFFICIAL: MACK C. GASTON Rear Admiral. United States Navy Commander, FCDNA

UNCLASSIFIED

N.A.

UNULASSIFIED

Concentration in the second for the N.

GERALD G. WATSON Major General, United States Army Director

This publication is hereby released by the Department of Energy for the use of concerned personnel.

BRUCE G. TWINING Manager, Albuquerque Operations U. S. Department of Energy

B-18

